





**FRW : MILLSHRED** - Face mills carrying round inserts with serrated cutting edges or regular round inserts. Used for rough machining small dies and low power machines.

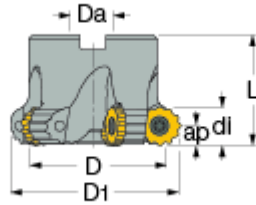

Designation	D1	D	di	Z	L	Da	Rd?/b>	ap	Coolant	Arbor	Kg
FRW D028A040-04-16-12	40.0	28.00	12.00	4	40.00	16.00	6.5	6.00	Y	A	0.32
FRW D038A050-05-22-12	50.0	38.00	12.00	5	45.00	22.00	5.0	6.00	Y	A	0.45
FRW D040A052-05-22-12	52.0	40.00	12.00	5	45.00	22.00	5.0	6.00	Y	A	0.47
FRW D051A063-06-22-12	63.0	51.00	12.00	6	45.00	22.00	4.0	6.00	Y	A	0.64
FRW D054A066-06-27-12	66.0	54.00	12.00	6	50.00	27.00	4.0	6.00	Y	A	0.69
FRW D068A080-07-27-12	80.0	68.00	12.00	7	50.00	27.00	3.0	6.00	-	B	0.86
FRW D034A050-04-22-16	50.0	34.00	16.00	4	54.00	22.00	11.0	8.00	Y	A	0.43
FRW D034A050-04-22.22-16	50.0	34.00	16.00	4	54.00	22.22	11.0	8.00	Y	A	0.42
FRW D036A052-04-22-16	52.0	36.00	16.00	4	50.00	22.00	10.0	8.00	Y	A	0.25
FRW D047A063-05-22-16	63.0	47.00	16.00	5	45.00	22.00	7.0	8.00	Y	A	0.40
FRW D047A063-05-22.22-16	63.0	47.00	16.00	5	45.00	22.22	7.0	8.00	Y	A	0.58
FRW D050A066-05-22-16	66.0	50.00	16.00	5	45.00	22.00	6.0	8.00	Y	A	0.42
FRW D050A066-05-27-16	66.0	50.00	16.00	5	50.00	27.00	6.0	8.00	Y	A	0.63
FRW D064A080-06-25.4-16	80.0	64.00	16.00	6	50.00	25.40	5.0	8.00	-	B	0.66
FRW D064A080-06-27-16	80.0	64.00	16.00	6	50.00	27.00	5.0	8.00	-	B	0.80
FRW D084A100-07-31.75-16	100.0	84.00	16.00	7	50.00	31.75	4.0	8.00	-	B	1.00
FRW D084A100-07-32-16	100.0	84.00	16.00	7	50.00	32.00	4.0	8.00	-	B	1.38
FRW D109A125-07-40-16	125.0	109.00	16.00	7	63.00	40.00	3.0	8.00	-	B	2.60
FRW D060A080-05-25.4-20	80.0	60.00	20.00	5	50.00	25.40	7.0	10.00	-	B	0.80
FRW D060A080-05-27-20	80.0	60.00	20.00	5	50.00	27.00	7.0	10.00	-	B	0.76
FRW D080A100-06-32-20	100.0	80.00	20.00	6	50.00	32.00	5.0	10.00	-	B	1.26
FRW D105A125-07-40-20	125.0	105.00	20.00	7	63.00	40.00	4.0	10.00	-	B	2.23
FRW D140A160-08-40-20	160.0	140.00	20.00	8	63.00	40.00	3.0	10.00	-	C	4.02